

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	1

Customer:
 Merrins, Brian
 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 616-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 1 Technician: SCOTT

CUSTOMER STATES: Car has been sparingly used since 2006, total miles since 1990 is 10k miles. Overall evaluation of vehicle. check car over and make recommendations as follows: compression test, vacuum test, steering gear box, subframe mounts, exhaust, flex disk, rear axle bushings, oil leaks in front of engine, brakes, shocks, brakes calipers, brake pads and rotors. This car is a candidate for cryogenic dry ice blasting, determine process if exhaust gets removed and shipped to cryo clean. check air suspension valve date codes, these are new valves. check tires, they seem to be dry rotted. upgrade tires to 6.3 size of 215/70/14 instead of the 195/75/14 presently on car. check chain tensioner and rocker arm for valve train noise. check water pump and date code. check all rubber hoses thru out car, check fuel pump, fuel hoses, gas tank. car came with gas smell from aftermarket fuel pump for cis car, fuel pressure is at 80 psi for this pump, see if regulators have been adjusted to reduce pressure to 24 psi. check kingpins, lower king pin mounts drag link, torque upper and lower control arm bolts on subframe (probably loose), check steering box for leaks and steering coupling.

WORK PERFORMED:

LABOR	2.00	95.00	190.00
PARTS TOTALS FOR THIS JOB:			\$0.00
TOTAL LABOR FOR THIS JOB			\$190.00
TOTAL PARTS AND LABOR			\$190.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	2

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc				
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018				
Job #	Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job:2 Technician: SCOTT

CUSTOMER STATES: Group 03, Timing chain is loose. valve train noisy, camshafts are excellent, heads have been redone.

WORK PERFORMED: Replace timing chain, timing chain tensioner and valve cover gaskets, replace copper washers on valve covers. check tdc. check guide rails, rocker arms and ball studs are worn as well as rocker. cams are good. set valve lash to .08mm and .25mm intake and exhaust respectively

Job #	Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
		LABOR		24.00	95.00	2,280.00
000-997-75-94		Timing chain for W116.981. 186 links. SEE NOTES.		1.00	129.00	129.00
110-055-11-93		Timing spring for W110.921, 16x car		16.00	3.00	48.00
116-016-13-21		Left valve cover gasket for W116.980		1.00	12.50	12.50
116-016-14-21		Right valve cover gasket for W116.980		1.00	12.50	12.50
116-050-11-20		Non hydraulic ball stud assembly for W116.981. Use rocker arm 116-055-15-01		16.00	53.00	848.00
116-050-16-11		Chain tensioner for W116.981		1.00	230.00	230.00
116-055-15-01		Rocker arm for W116.981		16.00	66.00	1,056.00
116-180-00-84		Connector repair kit for W116.981		2.00	13.50	27.00
915035-000016		Crush ring for valve cover for W116, 4x/valve cover.		8.00	1.00	8.00

PARTS TOTALS FOR THIS JOB: \$2,371.00
TOTAL LABOR FOR THIS JOB \$2,280.00
TOTAL PARTS AND LABOR \$4,651.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	3

Customer:
 Merrins, Brian
 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc				
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018				
Job #	Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 3 Technician: SCOTT

CUSTOMER STATES: Group 15 Tune up car, check hoses.
WORK PERFORMED: Install ignition points, set timing, check vacuum advance, point gap, set CO level, check EFI control unit for CO adjustment, set idle. check condition of all rubber hoses in engine bay.

Job #	Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
		LABOR		4.00	95.00	380.00
000-158-23-31		Distributor rotor for W100 and W109.018 short number 04-018 04018		1.00	47.00	47.00
000-158-26-02		Distributor cap for W100.981 or W109.018, Bosch 03-015		1.00	120.00	120.00
000-158-36-90		Ignition point for W100.980. Bosch # 01-057		1.00	15.00	15.00
003-159-12-03		w7dc spark plug for W100.981 w7dc0		8.00	4.00	32.00
WIRE SET 45		Ignition wire set for 4.5 liter engines. original wire set with numbers		1.00	200.00	200.00
<u>PARTS TOTALS FOR THIS JOB:</u>						\$414.00
<u>TOTAL LABOR FOR THIS JOB</u>						\$380.00
<u>TOTAL PARTS AND LABOR</u>						\$794.00

[REDACTED]

[REDACTED]

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	4

Customer:
 Merrins, Brian
 Wingmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 4 Technician: SCOTT

CUSTOMER STATES: Group 07 Injection, rubber hoses and Detail engine bay, many hoses are worn out. some injectors have been repaired with hose kit. leave these alone. the seals may be repaired when the heads were done.

WORK PERFORMED: Remove air cleaner, all metal brackets and plate to original specification. install all new hoses as needed. replace transmission cooler hoses, paint any associated parts that are worn to original specification. all linkage balls for accelrator linkage replace. replate all original clamps as required. Plating will be done with yellow cadmium plate, silver plate and clear plating. similar results to 280se 4.5 that have been done in the past, review these pictures on the flickr.

	LABOR			
		50.00	95.00	4,750.00
001-094-27-04	Air filter for W116.980 or W117	1.00	67.00	67.00
001-997-69-90	Nylon loom tie for fuel hoses on W109	4.00	2.00	8.00
114-203-00-80	EFI gasket for warm up regulator on W100.980	1.00	1.00	1.00
114-997-18-82	Return hose to fuel tank for W109, W108, W111, W112. Sold by meter. See Notes.	1.00	17.50	17.50
116-094-00-91	Breather boot for W116.981	1.00	10.00	10.00
116-094-01-91	Air hose for air slide on W117.981	1.00	21.00	21.00
116-301-01-50	Insert bushing for W116, fits 126-301-04-85 ball	2.00	1.00	2.00
116-988-05-11	Fuel mount buffer for W100, up to 001377, 3x car air cleaner mount	1.00	4.20	4.20
116-988-05-11	Fuel mount buffer for W100, up to 001377, 3x car air cleaner mount	1.00	4.20	4.20
116-997-01-82	Air slide hose to muffler fillter on W116.981, up to engine 005562, see notes.	1.00	2.50	2.50
116-997-01-82	Air slide hose to muffler fillter on W116.981, up to engine 005562, see notes.	1.00	2.50	2.50
116-997-02-82	Idling air distributor hose to muffler filter for W116.981, up to engine 005562	1.00	13.50	13.50
116-997-02-82	Idling air distributor hose to muffler filter for W116.981, up to engine 005562	1.00	13.50	13.50
116-997-12-82	Intake manifold hose for W116.981, up to engine 005562 1	1.00	6.50	6.50
116-997-12-82	Intake manifold hose for W116.981, up to engine 005562 1	1.00	6.50	6.50
117-094-00-91	Air cleaner boot for W116.981, from engine 005563	1.00	11.50	11.50
126-301-04-85	accelerator bushing for W126. also uses	2.00	2.00	4.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	5

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc				
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018				
Job #	Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

116-301-01-50 insert

PARTS TOTALS FOR THIS JOB: \$195.40
TOTAL LABOR FOR THIS JOB \$4,750.00
TOTAL PARTS AND LABOR \$4,945.40

 
Job: 5 Technician: SCOTT

CUSTOMER STATES: Group 32 front and rear suspension. shocks are original. king pin lower bushing are loose rebush. Subframe mounts are broken, replace. Replace simple items drag link and tie rods. replace motors mounts, collapsed, replace transmission mount collapsed. Tighten upper and lower control arms bolts are loose, torque to spec. align car.

WORK PERFORMED: replace front and rear shocks. replace subframe mounts, replace suspension components as addressed. set toe to zero, camber to .45 caster to 4 degrees

LABOR		20.00	95.00	1,900.00
107-330-01-03	Front axle tie rod w/left & right ends for W109	2.00	85.00	170.00
108-330-02-75	Front subframe repair kit for W109. See notes.	1.00	348.00	348.00
109-320-00-30	Bilstein front shock absorber for W109. Bilstein #B36 507. 2x car 244-005074 oe number	2.00	136.00	272.00
109-320-00-31	Rear shock absorber for W109. Bilstein #B 46 534. 2x car	2.00	144.00	288.00
110-460-02-05	Center drag link for W109 w111 w113 w108	1.00	129.00	129.00
111-330-03-30	Lateral cross strut support from unit body to subframe for W108	1.00	165.00	165.00
112-333-01-65	Upper control arm bumper stops for W109, 4x car	4.00	6.25	25.00
112-333-02-65	Lower control arm stop for W109, 4x car	4.00	20.00	80.00
116-223-12-04	Left motor mount for W111.026	1.00	75.00	75.00
116-223-13-04	Right motor mount for W111.026	1.00	75.00	75.00
116-240-04-18	Rear transmission mount for W108	1.00	104.00	104.00
ALIGNMENT	4 wheel alignment	1.00	135.00	135.00

PARTS TOTALS FOR THIS JOB: \$1,866.00
TOTAL LABOR FOR THIS JOB \$1,900.00
TOTAL PARTS AND LABOR \$3,766.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	6

Customer:
 Merrins, Brian
 Wagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job:6 Technician: SCOTT


CUSTOMER STATES: Group 32, rebuild air suspension

Rebuild air suspension system for 300sel 3.5.
 Change all valve, linkages and line that are flexible.
 Remove drain tank and clean if needed. Rebuild drain valve. Install check valve. Set car to correct height.
 Change air bellows front and rear. Rebuild pressure switch on main valve. Check function of pull out cable for height adjustment. Make sure warning light functions properly. Change all leveling rods and linkages. Cadmium plate lines if required only in the engine bay. Do not paint lines unless absolutely necessary.

Rebuild air bags as needed with new cans.

WORK PERFORMED: Install pieces as required. Note air suspension linkage rods must be omitted from parts list since they contain both 4.5 rods and 6.3 correct for car that is being used on.

Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
	LABOR		28.00	95.00	2,660.00
000-327-16-25	air suspension tank check valve for W109, Bosch # 0500100003. SEE NOTES!		1.00	307.00	307.00
000934-006007	Right hand 6 mm threaded nut for air suspension rod on W109. SEE NOTES.		3.00	0.30	0.90
000934-006012	Left hand 6mm threaded nut for air suspension rod on W109. SEE NOTES.		3.00	0.50	1.50
000966-006007	Chrome plated screw for front air chamber cones on W109, 10x car. SEE NOTES.		10.00	1.00	10.00
002-997-85-45	Air line conection O ring 8mm x 2mm for W100 or W109. See Notes.		10.00	1.00	10.00
109-997-17-82	Air suspension flexible hose for W109.018. See notes. no longer available.		3.00	150.00	450.00
112-320-36-15	Left front air bag chamber w/air bag assembled and tested for W109		1.00	700.00	700.00
112-320-37-15	Right front air bag chamber w/air bag assembled and tested for W109		1.00	700.00	700.00
112-320-42-15	Left rear air bag chamber w/air bag assembled and tested for W109 see notes		1.00	700.00	700.00
112-320-43-15	Right rear air bag chamber w/air bag assembled and tested for W109		1.00	700.00	700.00
123-328-00-63	Right hand threaded linkage for air suspension rod.		3.00	12.00	36.00

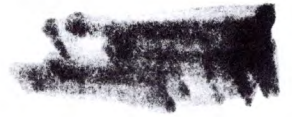

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	7

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468 Alternate Phone: Terms: cc
 Service Rep: NEIL Cust PO: Status: CLOSED Due Date: 3/20/2018

Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
123-328-01-63	Left hand threaded linkage for air suspension rod.		3.00	12.00	36.00
LF EVA 1A3	Main air valve for W109 bosch 0501001004, rebuilt. See notes.		1.00	895.00	895.00
LF/VNC 3/1	Right front rebuilt late style: Bosch long number 050003004. LF/VNC 3/1		1.00	795.00	795.00
LF/VNC 3/2	left front rebuilt late style: bosch long number 0500003005. LF/VNC 3/2		1.00	795.00	795.00
LF/VNC 4/3	Rear valve rebuilt late style: Bosch long number 0500003006. LF/VNC 4/3		1.00	795.00	795.00

PARTS TOTALS FOR THIS JOB: \$6,931.40
TOTAL LABOR FOR THIS JOB \$2,660.00
TOTAL PARTS AND LABOR \$9,591.40

Job: 7 Technician: SCOTT

CUSTOMER STATES: Group 42. bleed front and rear brakes. brake are original but good.
WORK PERFORMED: calipers are all original and functional. Customer to decide to replace brakes with new.

LABOR		2.00	95.00	190.00
BRAKE FLUID	ATE brake fluid, 1 liter super blue, bf 1sb, DOT 4	1.00	21.00	21.00

PARTS TOTALS FOR THIS JOB: \$21.00
TOTAL LABOR FOR THIS JOB \$190.00
TOTAL PARTS AND LABOR \$211.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	8

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended


Job: 8 Technician: SCOTT

CUSTOMER STATES: Group 46 steering. steering box coupler is wornout. steering box is extremely loose and difficult to steer.

WORK PERFORMED: replace steering gear box and coupler, replace bolts, torque bolt to 45 lbs paint mark bolts

Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
	LABOR		8.00	95.00	760.00
000-463-51-32	Steering shock absorber , steering dampner w108, w111, w113, w109		1.00	58.00	58.00
000931-010253	steering gear box bolts for W113, 3x car. SEE NOTES.		3.00	4.00	12.00
112-460-25-01	Rebuilt power steering gearbox for W112, w/out pitman arm.		1.00	1,250.00	1,250.00
115-460-05-10	Steering coupling for W108.018, from 058444		1.00	127.00	127.00

 PARTS TOTALS FOR THIS JOB: \$1,447.00
TOTAL LABOR FOR THIS JOB \$760.00
TOTAL PARTS AND LABOR \$2,207.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	9

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 9 Technician: SCOTT

CUSTOMER STATES: Group 49 exhaust system is worn out, use factory mercedes system.
WORK PERFORMED: Replace exhaust

Job # Stock Code	Description	Quantity	Price	Extended
	LABOR	12.00	95.00	1,140.00
000-492-00-53	Main muffler suspension spacer tube for W109 & 300sel 6.3 ID 9mm x12mm x 41mm, 3x per car	2.00	1.30	2.60
000-492-03-43	Exhaust clamp center resonator w/o stud for W113.044 & W109.018 108067 280sel 4.5 used on 280sl rear muffler	1.00	3.00	3.00
000-492-08-43	000-492-08-43 Muffler clamp for W108 V 3 E11	1.00	10.00	10.00
000-492-09-43	000-492-09-43 Clamp for rear muffler on W108 mustache with hat V 8 E 10/v8k1	1.00	7.00	7.00
000-492-11-83	Central exhaust pipe suspension bridge for W116.032	1.00	8.00	8.00
107-490-00-41	Exhaust clamp for W109.057, 52-55 mm 53.5mm actual size	1.00	8.00	8.00
107-490-00-41	Exhaust clamp for W109.057, 52-55 mm 53.5mm actual size	1.00	8.00	8.00
107-492-00-82	Rubber dampening donut on rear muffler for W109. 4x car 111	4.00	1.70	6.80
109-490-00-20	Right front header pipe for W109.056	1.00	490.00	490.00
109-490-02-15	Center muffler w/pipe for W109.056	1.00	1,170.00	1,170.00
109-490-04-19	Left header pipe for W109.056	1.00	78.00	78.00
109-491-04-01	Rear muffler for w109.056	1.00	535.00	535.00
109-492-06-04	Rear exhaust pipe for W109.056	2.00	114.00	228.00
113-492-02-14	Rear muffler chrome tips for W108.018 w113 45.5mm small tips	2.00	31.00	62.00
915035-000023	42 id x 47 mm od exhaust seal ring for M117, 2x/car	2.00	3.00	6.00

PARTS TOTALS FOR THIS JOB: \$2,622.40
TOTAL LABOR FOR THIS JOB \$1,140.00
TOTAL PARTS AND LABOR \$3,762.40

[REDACTED]

[REDACTED]

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	10

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 10 Technician: SCOTT

CUSTOMER STATES: Group 35, rear axle, check axle for rubber mounts. replace differential fluid. grease rear momentum counter and check for chatter on reverse for bushings. car has alot of oil after cryogenic cleaning a better dermination can be made.


WORK PERFORMED: Inspect rear suspension bushings. center support for differentail is worn. would recommend replacing, repalcing traling arm mounts and center support as needed. quoted time with out center support. replace momentum counter bushings. only one hour of time allotted.

Job # Stock Code	Description	Quantity	Price	Extended
	LABOR	1.00	95.00	95.00
109-420-00-78A	2.8mm white plastic shim for rear bearing on W109, 2x per car	2.00	200.00	400.00
112-350-04-75	Rear axle trunk suppprt for W109	1.00	765.00	765.00
80-90 OIL	80-90 weight Kendall limited slip oil	1.50	8.00	12.00
PARTS TOTALS FOR THIS JOB:				\$1,177.00
TOTAL LABOR FOR THIS JOB				\$95.00
TOTAL PARTS AND LABOR				\$1,272.00

Job: 11 Technician: SCOTT

CUSTOMER STATES: Group 01, service car,
WORK PERFORMED: change oil filter, transmission filter, anti freeze device.

Job # Stock Code	Description	Quantity	Price	Extended
	LABOR	3.00	95.00	285.00
000-180-06-09	oil filter kit for W116 & W117, Hengst E121HD01	1.00	10.00	10.00
109-270-02-98	Transmission filter for W109.056, from 000176	1.00	43.50	43.50
10W-40	10w-40 engine oil	9.00	5.00	45.00
112-271-09-80	Transmission pan gasket for W108.018	1.00	7.25	7.25
ATF	Dexron Type 3 automatic transmission fluid	7.00	5.00	35.00
PARTS TOTALS FOR THIS JOB:				\$140.75
TOTAL LABOR FOR THIS JOB				\$285.00
TOTAL PARTS AND LABOR				\$425.75

 

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	11

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 12 Technician: SCOTT

CUSTOMER STATES: Group 20, water pump has small weep. car has heavy oil leak comming from air compressor,
WORK PERFORMED: replace thermostat, water pump and hoses as needed. replace all belts as needed. remove air compressor and replace.

Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
	LABOR		12.00	95.00	1,140.00
001-131-84-01	Air compressor for W117.981 or W109.056, rebuilt		1.00	1,450.00	1,450.00
003-997-55-45	air compressor o ring 42 mm id x 3 mm for W100. air compressor base oring		1.00	5.00	5.00
008-997-95-82	Air compressor oil hose for W116.981		1.00	134.00	134.00
116-200-00-15	75 degree thermostat for W117.981		1.00	20.00	20.00
116-203-02-82	Water pump hose for W116.981		1.00	6.00	6.00
117-200-33-01	Water pump for W116.961		1.00	278.00	278.00
900271-042000	42mm id x 75mm long thermostat return hose for W100.981, thermoid 16010016203 no green stripe black hose		1.00	35.00	35.00
Q-1-03-0002	Mercedes Benz factory yellow antifreeze w/ Bitrix.		1.00	24.00	24.00

PARTS TOTALS FOR THIS JOB: \$1,952.00
TOTAL LABOR FOR THIS JOB \$1,140.00
TOTAL PARTS AND LABOR \$3,092.00

Job: 13 Technician: scott

CUSTOMER STATES: Group 07 change belts
WORK PERFORMED: change all belts as noted, add size of a/c blet to order. check check wiring in engine bay.

Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
	LABOR		2.00	95.00	190.00
005-997-82-92	a/c belt 12.5 x 868 mm for W115.951		1.00	20.00	20.00
006-997-25-92	Alternator belt, 10x950, for W116.980		1.00	10.00	10.00
006-997-29-92	Air compressor belt, 10x838, for W116.980		1.00	10.00	10.00
006-997-34-92	Power steering belt. 10x1225, for W116.980, up to 006513		1.00	13.00	13.00

PARTS TOTALS FOR THIS JOB: \$53.00
TOTAL LABOR FOR THIS JOB \$190.00
TOTAL PARTS AND LABOR \$243.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	12

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 616-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 14 Technician: SCOTT

CUSTOMER STATES: Group 83 check a/c, check heat
WORK PERFORMED: check vent temperature and record. Check blower motor and heater function heater works ok a/c no charge in system will have to be TBD.

LABOR	1.00	95.00	95.00
PARTS TOTALS FOR THIS JOB:			\$0.00
TOTAL LABOR FOR THIS JOB			\$95.00
TOTAL PARTS AND LABOR			\$95.00

Job: 15 Technician: NEIL

CUSTOMER STATES: Group 67, unibody cleaning, send car out for under carriage detailing, approximate cost for transportation and cryogenic under carriage cleaning.
WORK PERFORMED: send to cryo genic dry ice blast clean. remove sheels and exhasut system. after cleaning respray areas with proper coating to get orginal finish. this is an approximate coat only for cleaning. we will do detail work on car. will include labor time as work progresses.

*. cryogenic dry ice blasting.	1.00	3,500.00	3,500.00
PARTS TOTALS FOR THIS JOB:			\$3,500.00
TOTAL LABOR FOR THIS JOB			\$0.00
TOTAL PARTS AND LABOR			\$3,500.00

Job: 16 Technician: scott

CUSTOMER STATES: Group 40, replace tires dry rotted.
WORK PERFORMED: replace tires with 300sel 6.3 tire size 215/70/14 determine if customer wants white walls.

215/70/14M	215/70/R14 Michelin Harmony tire	4.00	110.00	440.00
TIRE BALANCE	Balance tire on tire load balancer	4.00	15.00	60.00
PARTS TOTALS FOR THIS JOB:				\$500.00
TOTAL LABOR FOR THIS JOB				\$0.00
TOTAL PARTS AND LABOR				\$500.00

[REDACTED]

[REDACTED]

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	13

Customer:
 Merrins, Brian
 7 Wlagmaire Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job: 17 Technician: scott

CUSTOMER STATES: Group 47 fuel pump has small gas leak, non original fuel pump CIS car.
WORK PERFORMED: Replace incorrect CIS fuel pump, replace filter. replace hoses as needed

Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
	LABOR		3.00	95.00	285.00
000-092-76-01	Efi fuel filter for W109.056		1.00	38.00	38.00
001-091-74-01	EFI fuel pump for W109 3.5 up to 005792. See Notes.		1.00	1,100.00	1,100.00
001-997-69-90	Nylon loom tie for fuel hoses on W109		1.00	2.00	2.00
112-476-12-26	11mm id cohline fuel hose feed from 10mm tank line to fuel pump, cotton braid, for W100 & W109.018, cut to fit. Sold By Meter		1.00	21.00	21.00
114-997-18-82	Return hose to fuel tank for W109, W108, W111, W112. Sold by meter. See Notes.		1.00	17.50	17.50
126-988-00-11	Pump/filter bracket buffer to cross member bracket on W126		6.00	6.00	36.00

PARTS TOTALS FOR THIS JOB: \$1,214.50
TOTAL LABOR FOR THIS JOB: \$285.00
TOTAL PARTS AND LABOR: \$1,499.50

Job: 18 Technician: scott

CUSTOMER STATES: Group 82, check function of central locking system. leak test system, check valve on tank.
WORK PERFORMED:

LABOR	1.00	95.00	95.00
PARTS TOTALS FOR THIS JOB:			\$0.00
TOTAL LABOR FOR THIS JOB:			\$95.00
TOTAL PARTS AND LABOR:			\$95.00

[REDACTED]

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	14

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job:19 Technician: SCOTT

CUSTOMER STATES: Group 27, shifter bushings for floor shifter and transmission.
WORK PERFORMED: Rebuild floor shifter with new bushings. Replace transmission bushing on automatic transmission

<u>LABOR</u>				
112-268-01-50	Shifter nylon bushing for w109.018 or w100. 1x car.	1.00	4.00	4.00
115-267-12-50	Floor shifter bushings for W116.036	2.00	1.00	2.00

PARTS TOTALS FOR THIS JOB: \$6.00
TOTAL LABOR FOR THIS JOB \$760.00
TOTAL PARTS AND LABOR \$766.00

Job:20 Technician: SCOTT

CUSTOMER STATES: group 01 check compression
WORK PERFORMED: perform compression test as needed, compression is good. 130 avg

<u>LABOR</u>				
		1.00	95.00	95.00

PARTS TOTALS FOR THIS JOB: \$0.00
TOTAL LABOR FOR THIS JOB \$95.00
TOTAL PARTS AND LABOR \$95.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	15

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job:21 Technician: SCOTT

CUSTOMER STATES: Group 86, windsheild washer foot pump does not work
WORK PERFORMED: replace foot pump, hoses, windshield fluid canister and top.

Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended
	LABOR		3.00	95.00	285.00
002-997-59-82	clear or amber windshield washer hose for W100 & W109 4mm ID x 6mm OD hose 3586N3 per foot		1.00	20.00	20.00
108-869-00-20	Windshield washer bottle for W109		1.00	189.00	189.00
115-820-00-45	Windshield wiper blade for w108, w109, w100 stainless steel, wiper blade		2.00	20.00	40.00
115-869-01-21	Windshield washer foot pump for early style with short extension. not used on 4.5's. core exchange core \$100		1.00	180.00	180.00
115-869-01-69	Plastic top for windshield washer reservoir for W109.018. SEE NOTES.		1.00	16.00	16.00
PARTS TOTALS FOR THIS JOB:					\$445.00
TOTAL LABOR FOR THIS JOB					\$285.00
TOTAL PARTS AND LABOR					\$730.00

Job:22 Technician: SCOTT

CUSTOMER STATES: Group 54, install decals
WORK PERFORMED: Install decals as follows: air suspension anti freeze decals, a/c decal, engine decal, snow flake, trunk decal (blue), radiator decal, gas tank decal for air pressure and oil.

DECAL SET	Decal set for M116 and W109		1.00	180.00	180.00
PARTS TOTALS FOR THIS JOB:					\$180.00
TOTAL LABOR FOR THIS JOB					\$0.00
TOTAL PARTS AND LABOR					\$180.00



Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	16

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: cc			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job:23 Technician: scott

CUSTOMER STATES: Group 32, air suspension, check air suspension alcohol chamber

WORK PERFORMED: add Crc brake line antifreeze.

AIR BRAKE ANTIFREEZE	Crc Industries 05532 Air Brake Anti-Freeze, 1-Qt. for air suspension systems, w109 100 w112		1.00	9.00	9.00
----------------------	---	--	------	------	------

PARTS TOTALS FOR THIS JOB: \$9.00
TOTAL LABOR FOR THIS JOB: \$0.00
TOTAL PARTS AND LABOR: \$9.00

Job:24 Technician: SCOTT

CUSTOMER STATES: Group 41, flex disc distorted. eccentric driveshaft vibration.

WORK PERFORMED: Replace front flex disk.

	LABOR		3.00	95.00	285.00
126-410-02-15	Flexible joint disc parts kit for W108.018, from 028985		1.00	112.00	112.00

PARTS TOTALS FOR THIS JOB: \$112.00
TOTAL LABOR FOR THIS JOB: \$285.00
TOTAL PARTS AND LABOR: \$397.00

Job:25 Technician:

CUSTOMER STATES: Radiator fan hit shroud

WORK PERFORMED: found radiator core support bent, remove radiator and condenser and straighten

	LABOR		30.00	95.00	2,850.00
--	--------------	--	-------	-------	----------

PARTS TOTALS FOR THIS JOB: \$0.00
TOTAL LABOR FOR THIS JOB: \$2,850.00
TOTAL PARTS AND LABOR: \$2,850.00

[REDACTED]

[REDACTED]

Star Motors
 Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	17

Customer:
 Merrins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 616-456-4468	Alternate Phone:	Terms: CC			
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018			
Job # Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Job:26 Technician: ERIC

CUSTOMER STATES: replace front and rear rotors, replace pads
WORK PERFORMED: vibration when applying brakes.

Job # Stock Code	Description	Quantity	Price	Extended
	LABOR	5.00	95.00	475.00
109-420-00-05	Vented front brake rotor for W108 late and W109 all 3.5, 4.5 and 6.3.	2.00	270.00	540.00
126-423-00-12	ATE rear brake rotor for W126, w108, w111, w109, zimmerman	2.00	64.00	128.00

PARTS TOTALS FOR THIS JOB: \$668.00
TOTAL LABOR FOR THIS JOB \$475.00
TOTAL PARTS AND LABOR \$1,143.00

Job:27 Technician:

CUSTOMER STATES: unable to reach customer for payment.
WORK PERFORMED: payed one year of storage \$3600or \$300 a month. climate controlled storage.

.*	august 2018 start date	12.00	300.00	3,600.00
.*	august 2019 to 2020	12.00	300.00	3,600.00
.*	till august 2021	12.00	300.00	3,600.00
.*	9/2/2222	6.00	300.00	1,800.00

PARTS TOTALS FOR THIS JOB: \$12,600.00
TOTAL LABOR FOR THIS JOB \$0.00
TOTAL PARTS AND LABOR \$12,600.00

Job:28 Technician: NEIL

CUSTOMER STATES: change oil and install new battery
WORK PERFORMED:

Job # Stock Code	Description	Quantity	Price	Extended
	LABOR	4.00	105.00	420.00
000-180-06-09	oil filter kit for W116 & W117, Hengst E121HD01	1.00	10.00	10.00
10W-40	10w-40 engine oil	9.00	5.00	45.00
MTP-49/H8	MTP 49/H8 battery	1.00	300.00	300.00

PARTS TOTALS FOR THIS JOB: \$355.00
TOTAL LABOR FOR THIS JOB \$420.00
TOTAL PARTS AND LABOR \$775.00



Star Motors

Facility #: 7081784
 1694 Union Center Highway
 Endicott, NY 13760-1341
 607-786-3918 Fax: 607-697-0511
 E-mail: starmotors@stny.rr.com
 Web Site: www.300sel.com

Date In:	3/20/2018
Date Out:	10/15/2018
Service Order #:	13726
Page:	18

Customer:
 Memins, Brian
 7 Wiagmore Road
 Riverside, CT 06878

Manufacturer: mercedes benz
 Model: 300sel 3.5
 Serial Number: 10905612003999
 Alternate ID:
 Reference:
 Mileage: 90790

Phone: 516-456-4468	Alternate Phone:	Terms: CC				
Service Rep: NEIL	Cust PO:	Status: CLOSED Due Date: 3/20/2018				
Job #	Stock Code	Description	Indications/Work Performed	Quantity	Price	Extended

Parts:	38,780.45	Labor:	21,605.00	Sublet:	0.00	Disposal:	0.00	Pickup/Delivery:	0.00
						Tax:	4,830.84	Service Call:	0.00
								Total:	65,216.29
								Prepaid:	42,500.00
								Paid:	0.00
								Balance:	22,716.29

I hereby authorize the above repairs _____

